

Manhole Inspection Summary

Manhole # S19W__027MH

Printed On: 1/15/2009

Page 1 of 5

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **19W** Node: **027** Status: **Found**

Insp Date: **7/1/08 8:48 AM**

Incomplete Comments

Crew: **REI**
Inspector: **paulfry**
Firm: **ATS**

Location Address: **2308 monterey st**

Cross Street: **james st**

Manhole Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **Sheeting**

Comments

Cover

Shape: **Circular**

Diameter: **24** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **2** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment

☒ Exists Material: **Brick and Concrete** ☐ Parged Height: **3** (in.)

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☒ **Loose Brick** ☒ **Deteriorated**

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☐ Sound ☒ **Cracked** ☐ Root Intrusion ☒ **Loose Brick** ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☒ **Wall**

Barrel

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: **0** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps

Count: **7** Missing: **0** ☒ **Corroded**

Surcharge

☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S19W__027MH


Printed On: 1/15/2009

Page 2 of 5

Location View



Top View

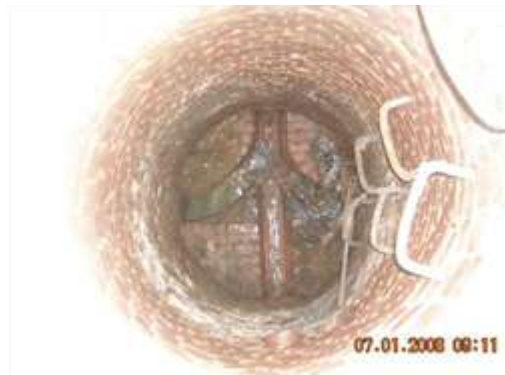

Sheeting Evidence



inflow evidence from sheeting

Defect 6



infiltration @ corbel wall

Defect 4



cracked and loose corbel bricks

Defect 3



cracked, loose bricks and deteriorated chimney

Manhole Inspection Summary

Manhole # S19W__027MH

Printed On: 1/15/2009

Page 3 of 5

Defect 2



corroded steps

Defect 1



frame offset

Manhole Inspection Summary

Manhole # S19W__027MH

Printed On: 1/15/2009

Page 4 of 5

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **11.94** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

6 in. Circular Gravity Sewer
Pipe In @ 3 O'Clock

3 O'Clock Inflow



Pipe Height: **6** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **11.62** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S19W__027MH

Printed On: 1/15/2009

Page 5 of 5

8 in. Circular Gravity Sewer

6 O'Clock Inflow

Pipe In @ 6 O'Clock

Drop In @ 6 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **7.22** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **Outside** Rod and Bar

Angled: **Yes** Reading: **10.62** (ft.)

Inv Depth: **11.62** (ft.)

Drop Condition: **Open**

Connects To: **Manhole**

☐ Possible Illicit Connection

8 in. Circular Gravity Sewer

9 O'Clock Inflow

Pipe In @ 9 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **11.83** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: **0** (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection